# Models 3140-CS

## Tension/Compression Pancake Load Cell



#### **DESCRIPTION**

The Model 3140-CS load cell series has been designed as a reference standard for calibration labs in automotive, aerospace, military or industrial markets. These tension/

compression load cells can be used when accuracy is a high priority requirement. Some advantages of these load cells are: compact size, high accuracy and availability.

#### **FEATURES**

- Enhanced accuracy, up to 0.02 %
- 300 lb to 100000 lb range
- Universal tension and compression loading
- Low profile
- 150 % full scale safe overload capability
- Available in single or optional dual bridge configuration
- Metric sizes available
- Factory installed calibration adapters
- Eccentric load compensated
- High precision base installed

### Model 3140-CS

#### PERFORMANCE SPECIFICATIONS

Characteristic	Measure
Load range <sup>1</sup>	300, 500, 1000, 2000, 5000, 10000, 25000, 50000, 100000
Operation	Tension/compression
Resolution	Infinite
Standard calibration	Tension (+) and compression (-)

	300 lb to 2K lb	5K lb to 10K lb	25K lb to 100K lb
Non-linearity error (of full scale)	±0.02 %	±0.04 %	±0.04 %
Hysteresis error (of full scale)	±0.02 %	±0.04 %	±0.05 %
Non-repeatability (of full scale)	±0.005 %	±0.005 %	±0.005 %
Output @ rated ca- pacity (nominal)	2.0 mV/V	4.0 mV/V	4.0 mV/V

#### **ENVIRONMENTAL SPECIFICATIONS**

Characteristic	Measure					
Temperature, operating	-54 °C to 93 °C [-65 °F to 200 °F]					
Temperature, compensated	-9 °C to 46 °C [15 °F to 115 °F]					
Temperature effect, zero	0.08 % of rated output/100 °F					
Temperature effect, output	0.08 % of reading/100 °F					

#### **ELECTRICAL SPECIFICATIONS**

Characteristic	Measure
Strain gage type	Foil
Excitation (maximum)	10 Vdc or Vac RMS
Insulation resistance	> 5000 mOhm @ 50 Vdc
Input resistance (tolerance)	350 ohm ±40/-3.5 ohm
Output resistance (tolerance)	350 ohm ±3.5 ohm
Zero balance (tolerance)	±1.0 %
Electrical termination	PT02E-10-6P mates with PT06W-10-6S


#### **MECHANICAL SPECIFICATIONS**

Characteristic	Measure
Static overload capacity	150 % of nominal capacity
Material	Carbon steel
Creep	±0.01 %
Off-centered load sensitivity 300 lb to 2K lb	±0.10 %
Off-centered load sensitivity 5K lb to 100K lb	±0.25 %
Side load sensitivity 300 lb to 2K lb	±0.10 %
Side load sensitivity 5K lb to 100K lb	±0.25 %

#### **WIRING CODES**

Cable	
Red	(+) excitation
Black	(-) excitation
Green	(+) output
White	(-) output

#### **TYPICAL SYSTEM DIAGRAM**

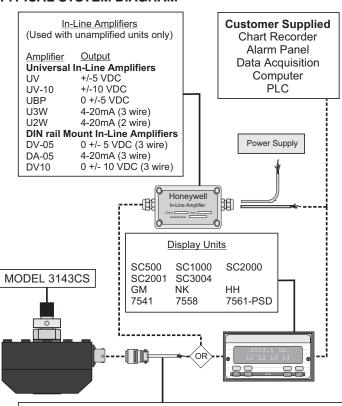

Mating Connectors & Cables

023-LW181-023-LF Mating Connector

7205-76-XX\* Mating connector & 6 conductor cable

(unamplified unit with sense leads but not shunt cal)

7205-75-XX\*\* Mating connector & 4 conductor cable

(unamplified unit without sense leads but not shunt cal)

7205-83-XX\* Mating connector & 6 conductor cable (for connection to instrument 7541)

7205-82-XX\*\* Mating connector & 4 conductor cable

(for connection to instrument 7541)

\* XX represents length in feet 100ft maximum

\*\* XX represents length in feet 20ft maximum

### Honeywell

## Tension/Compression Pancake Load Cell

(for connection to instrument 7541)

(for connection to instrument 7541)

20ft maximum

7205-82-XX\*\* Mating connector & 4 conductor cable

XX represents length in feet 100ft maximum

XX represents length in feet

#### TYPICAL SYSTEM DIAGRAM TYPICAL SYSTEM DIAGRAM **Customer Supplied** In-Line Amplifiers **Customer Supplied** In-Line Amplifiers (Used with unamplified units only) (Used with unamplified units only) Chart Recorder Chart Recorder Alarm Panel Alarm Panel Output **Output Data Acquisition Data Acquisition Universal In-Line Amplifiers Universal In-Line Amplifiers** Computer Computer +/-5 VDC +/-5 VDC UV UV **PLC** UV-10 +/-10 VDC UV-10 +/-10 VDC PLC UBP 0 +/-5 VDC UBP 0 +/-5 VDC 4-20mA (3 wire) 4-20mA (2 wire) U3W 4-20mA (3 wire) 4-20mA (2 wire) U3W U2W U2W **DIN rail Mount In-Line Amplifiers DIN rail Mount In-Line Amplifiers** Power Supply DV-05 0 +/- 5 VDC (3 wire) 0 +/- 5 VDC (3 wire) Power Supply DV-05 4-20mA (3 wire) 0 +/- 10 VDC (3 wire) DA-05 4-20mA (3 wire) DA-05 0 +/- 10 VDC (3 wire) DV10 DV10 Honeywell Honeywell **Display Units** Display Units SC2000 SC500 SC1000 SC500 SC1000 SC2000 MODEL 3144CS SC2001 SC3004 MODEL 3145CS SC2001 SC3004 GM NK GM NK HH 7541 7558 7561-PSD 7561-PSD 7541 7558 Mating Connectors & Cables Mating Connectors & Cables 023-LW181-023-LF Mating Connector 023-LW181-023-LF Mating Connector 7205-76-XX\* Mating connector & 6 conductor cable 7205-76-XX\* Mating connector & 6 conductor cable (unamplified unit with sense leads but not shunt cal) (unamplified unit with sense leads but not shunt cal) 7205-75-XX\*\* Mating connector & 4 conductor cable 7205-75-XX\*\* Mating connector & 4 conductor cable (unamplified unit without sense leads but not shunt cal) (unamplified unit without sense leads but not shunt cal) 7205-83-XX\* Mating connector & 6 conductor cable 7205-83-XX\* Mating connector & 6 conductor cable (for connection to instrument 7541)

7205-82-XX\*\* Mating connector & 4 conductor cable

\* XX represents length in feet 100ft maximum


\*\* XX represents length in feet 20ft maximum

(for connection to instrument 7541)

## **Model 3140-CS**

#### **MOUNTING DIMENSIONS**

Model	Capacity	ØΑ	B in	C in	D in	E in	F in	G in	Ø H in	J Thread	Ø K in	L Thread	M in.
	(lb)	in											
3143-CS-300	300	4.12	0.13	1.25	2.50	3.44	4.18	0.03	1.25	1/2-20 UNF 3A	6.00	1/2-20 UNF 3B	0.88
3143-CS-500	500	4.12	0.13	1.25	2.50	3.44	4.18	0.03	1.25	1/2-20 UNF 3A	6.00	1/2-20 UNF 3B	0.88
3143-CS-1K	1000	4.12	0.13	1.25	2.50	3.44	4.18	0.03	1.25	1/2-20 UNF 3A	6.00	1/2-20 UNF 3B	0.88
3143-CS-2K	2000	4.12	0.13	1.25	2.50	3.44	4.18	0.03	1.25	1/2-20 UNF 3A	6.00	1/2-20 UNF 3B	0.88
3144-CS-5K	5000	4.12	0.13	1.25	2.50	3.44	4.19	0.03	1.25	5/8-18 UNF 3A	6.00	5/8-18 UNF 3B	0.88
3144-CS-10K	10000	4.12	0.13	1.25	2.50	3.44	4.19	0.03	1.25	5/8-18 UNF 3A	6.00	5/8-18 UNF 3B	0.88
3145-CS-25K	25000	6.06	0.13	1.63	3.50	4.94	6.44	0.03	1.25	11/4-12 UNF 3A	6.00	11/4-12 UNF 3B	1.50
3145-CS-50K	50000	6.06	0.13	1.63	3.50	4.94	6.44	0.03	2.25	11/4-12 UNF 3A	6.00	11/4-12 UNF 3B	1.50
3146-CS-100K	100000	8.00	0.25	2.25	4.50	6.13	7.88	0.03	3.00	1¾-12 UNF 3A	12.00	1¾-12 UNF 3B	1.75

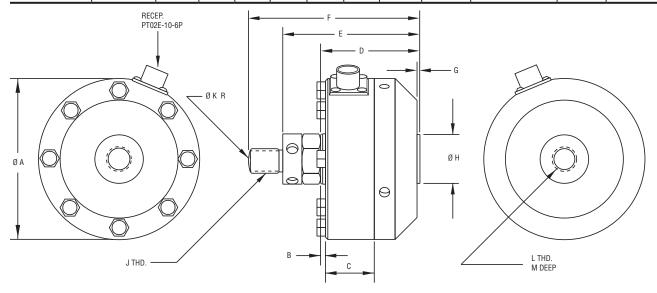


# SUNSTAR传感与控制 http://www.sensor-ic.com/ TEL:0755-83376549 FAX:0755-83376182 E-MAIL:szss20@163.com Model 3140-CS Tension/Compression Pancake Load Cell

#### **NOTES**

1. This unit calibrated to Imperial (non-Metric) units.

#### TYPICAL SYSTEM DIAGRAM

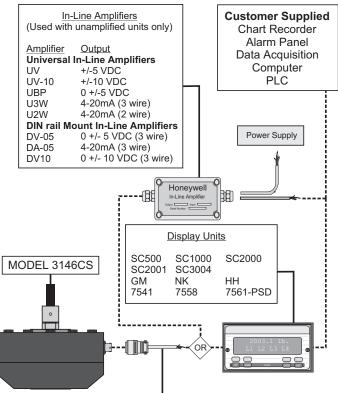

Mating Connectors & Cables

023-LW181-023-LF Mating Connector

7205-76-XX\* Mating connector & 6 conductor cable

(unamplified unit with sense leads but not shunt cal)

7205-75-XX\*\* Mating connector & 4 conductor cable

(unamplified unit without sense leads but not shunt cal)

7205-83-XX\* Mating connector & 6 conductor cable (for connection to instrument 7541)

7205-82-XX\*\* Mating connector & 4 conductor cable

(for connection to instrument 7541)

\* XX represents length in feet 100ft maximum

\*\* XX represents length in feet 20ft maximum Warranty. Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective. The foregoing is buyer's sole remedy and is in lieu of all warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.

For more information about Sensing and Control products, visit www.honeywell.com/sensing or call +1-815-235-6847 Email inquiries to info.sc@honeywell.com



• DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.



- The information presented in this catalogue is for reference only. DO NOT USE this document as product installation information.
- Complete installation, operation and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

Sensing and Control Automation and Control Solutions Honeywell 1985 Douglas Drive North Golden Valley, MN 55422 USA +1-815-235-6847

Honeywell

008626-1-EN IL50 GLO May 2008

Copyright @ 2008 Honeywell International Inc. All rights reserved.