

# **Data Sheet SHTC1** Humidity and Temperature Sensor IC for High-Volume Applications

- Best performance-to-price ratio
- Fully calibrated and reflow solderable
- Ultra-low power consumption
- Power-up and measurement within 1 ms
- 1.8 V supply voltage
- Ultra-small DFN package: 2 × 2 × 0.75 mm
- Typical accuracy: ±3 %RH and ±0.3 °C

### **Product Summary**

The SHTC1 is a digital humidity and temperature sensor designed especially for high-volume consumer electronics applications. This sensor is strictly designed to overcome conventional limits for size, power consumption, and performance to price ratio in order to fulfill current and future requirements. Sensirion's CMOSens<sup>®</sup> technology offers a complete sensor system on a single chip, consisting of a capacitive humidity sensor, a bandgap temperature sensor, analog and digital signal processing, A/D converter, calibration data memory, and a digital communication interface supporting I<sup>2</sup>C fast mode. The ultra-small,  $2 \times 2 \times 0.75$  mm<sup>3</sup> DFN package enables applications in even the most limited of spaces.

# The sensor covers a humidity measurement range of 0 to 100 %RH and a temperature measurement range of -30 to 100 °C with a typical accuracy of $\pm 3$ %RH and $\pm 0.3$ °C. The operation voltage of 1.8 V and an energy budget below 1 µJ per measurement make the SHTC1 suitable for mobile or wireless applications running on the tightest power budgets. With the industry-proven quality and reliability of Sensirion's humidity and temperature sensors and constant accuracy over a large measurement range, the SHTC1 offers an unprecedented performance-to-price ratio. Tape and reel packaging together with suitability for standard SMD assembly processes make the SHTC1 predestined for high-volume applications.

**Block diagram** 

### Benefits of Sensirion's CMOSens® Technology

- High reliability and long-term stability
- Industry-proven technology with a track record of more than 10 years
- Designed for mass production
- Optimized for lowest cost
- Low signal noise

### Contents of this Data Sheet

1 2 3	Humidity and Temperature Sensor Specifications Electrical Specifications Timing Specifications	. 3
4	Interface Specifications	
5	Operation and Communication	. 5
6	Quality	. 9
7	Packaging and Traceability	. 9
8	Ordering Information	. 9
9	Technical Drawings	10
10	Further Information	11

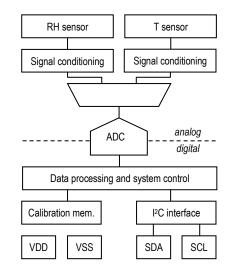


Figure 1 Functional block diagram of the SHTC1.

# 1 Humidity and Temperature Sensor Specifications

### **Relative Humidity**

Parameter	Conditions	Value	Units
Accuracy tolerance <sup>1</sup>	Тур.	±3.0	%RH
Accuracy tolerance	Max.	see Figure 2	%RH
Repeatability <sup>2</sup>		0.1	%RH
Resolution <sup>3</sup>		0.01	%RH
Hysteresis		±1	%RH
Specified range <sup>4</sup>	extended⁵	0 to 100	%RH
Response time6	τ 63%	8	S
Long-term drift	Normal range	<0.5	%RH/y

 Table 1 Humidity sensor specifications.

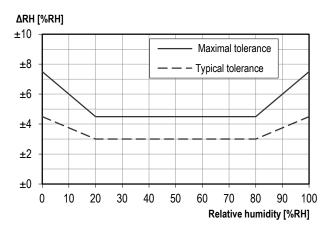


Figure 2 Typical and maximal tolerance for relative humidity in %RH at 25 °C.

### Temperature

Parameter	Conditions	Value	Units
Accuracy tolerance <sup>1</sup>	Тур.	±0.3	°C
Accuracy tolerance	Max.	see Figure 3	°C
Repeatability <sup>2</sup>		0.1	°C
Resolution <sup>3</sup>		0.01	°C
Specified range <sup>4</sup>		-30 to +100	°C
Response time <sup>7</sup>	τ 63%	<5 to 30	S
Long-term drift	Normal range	<0.04	°C/y

Table 2 Temperature sensor specifications.

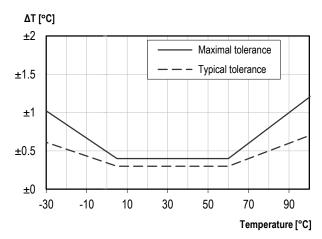


Figure 3 Typical and maximal tolerance for temperature sensor in °C.

<sup>1</sup> For definition of typ. and max. accuracy tolerance, please refer to the document "Sensirion Humidity Sensor Specification Statement".

 $^2$  The stated repeatability is 3 times the standard deviation (3 $\sigma$ ) of multiple consecutive measurement values at constant conditions and is a measure for the noise on the physical sensor output.

<sup>6</sup> Time for achieving 63% of a humidity step function, valid at 25°C and 1 m/s airflow. Humidity response time in the application depends on the design-in of the sensor.

<sup>&</sup>lt;sup>3</sup> Resolution of A/D converter.

<sup>&</sup>lt;sup>4</sup> Specified range refers to the range for which the humidity or temperature sensor specification is guaranteed.

<sup>&</sup>lt;sup>5</sup> For details about recommended humidity and temperature operating range, please refer to section 1.1.

### 1.1 Recommended Operating Conditions

The sensor shows best performance when operated within recommended normal temperature and humidity range of 5 - 60 °C and 20 - 80 %RH, respectively. Long term exposure to conditions outside normal range, especially at high humidity, may temporarily offset the RH signal (e.g. +3%RH after 60h at >80%RH). After returning into the normal temperature and humidity range the sensor will slowly come back to calibration state by itself. For accelerated elimination of the offset, see the document

"Application Guide for SHTC1", section "Reconditioning Procedure". Prolonged exposure to extreme conditions may accelerate ageing.

THE SENSOR COMPANY

To ensure stable operation of the humidity sensor, the conditions described in the document "Application Guide for SHTC1", section "Storage and Handling Instructions" regarding exposure to volatile organic compounds have to be met. Please note as well that this does apply not only to transportation and manufacturing, but also to operation of the SHTC1.

# 2 Electrical Specifications

### 2.1 Electrical Characteristics

Default conditions of 25 °C and 1.8 V supply voltage apply to values in the table below, unless otherwise stated.

Parameter	Symbol	Conditions	Min	Тур.	Max	Units	Comments
Supply voltage	V <sub>DD</sub>		1.62	1.8	1.98	V	
Power-up/down level	VPOR	Static power supply	1.05	1.2	1.35	V	
		Idle state		0.7	2.2	μA	
Supply current		Measurement		385	465	μA	Average current consumption while sensor is measuring <sup>8</sup>
	DD	Average		4.8		μA	Average current consumption (continuous operation with one measurement per second) <sup>8</sup>
Energy consumption per measurement				7.5		μJ	Energy needed to perform one RH and T measurement <sup>8</sup>
Low level input voltage	VIL		-0.5		0.3 V <sub>DD</sub>	V	
High level input voltage	Vін		0.7 V <sub>DD</sub>		V <sub>DD</sub> (max) + 0.5	V	
Low level output voltage	Vol	3 mA sink current			0.2 V <sub>DD</sub>		

 Table 3 Electrical specifications.

### 2.2 Absolute Maximum Ratings

Stress levels beyond those listed in Table 4 may cause permanent damage to the device. These are stress ratings only and functional operation of the device at these conditions cannot be guaranteed. Exposure to the absolute maximum rating conditions for extended periods may affect the reliability of the device.

Parameter	Rating
Supply voltage, V <sub>DD</sub>	-0.3 to +2.16 V
Operating temperature range	-40 to +125 °C
Storage temperature range <sup>9</sup>	-40 to +125 °C
ESD HBM	2 kV
ESD MM	200 V
ESD CDM	500 V
Latch up, JESD78 Class II, 125°C	100mA

Table 4 Absolute maximum ratings.

<sup>&</sup>lt;sup>8</sup> These values can be reduced by using the low power measurement mode, see separate application note.

<sup>&</sup>lt;sup>9</sup> The recommended storage temperature range is 10-50°C. Please consult the document "Application Guide for SHTC1" for more information.

SENSIRION

# 3 Timing Specifications

### 3.1 Sensor System Timings

Default conditions of 25 °C and 1.8 V supply voltage apply to values the table below, unless otherwise stated. Max. values are measured at -30°C and 1.98V supply voltage.

Parameter	Symbol	Conditions	Min.	Тур.	Max.	Units	Comments
Power-up time	tpu	After hard reset, $V_{DD} \ge V_{POR}$		172	229	μs	Time between $V_{\text{DD}}$ reaching $V_{\text{PU}}$ and sensor entering idle state
Soft reset time	tsr	After soft reset.		173	230	•	Time between ACK of soft reset command and sensor entering idle state
Measurement duration	t <sub>MEAS</sub>			10.8	14.4		Duration for a humidity and temperature measurement <sup>10</sup>

Table 5 System timing specifications.

### 3.2 Communication Timings


Default conditions of 25 °C and 1.8 V supply voltage apply to values in the table below, unless otherwise stated.

Parameter	Symbol	Conditions	Min.	Тур.	Max.	Units	Comments
SCL clock frequency	<b>f</b> sc∟		0		400	kHz	
Hold time (repeated) START condition	t <sub>hd;sta</sub>	After this period, the first clock pulse is generated	0.6			μs	
LOW period of the SCL clock	t∟ow		1.3			μs	
HIGH period of the SCL clock	<b>t</b> HIGH		0.6			μs	
Set-up time for a repeated START condition	t <sub>su;sta</sub>		0.6			μs	
SDA hold time	<b>t</b> hd;dat		0				
SDA set-up time	t <sub>su;dat</sub>		100			ns	
SCL/SDA rise time	t <sub>R</sub>		20		300	ns	
SCL/SDA fall time	t⊧		20 * (V <sub>DD</sub> /5.5)		300	ns	
SDA valid time	t <sub>VD;DAT</sub>				0.9	μs	
Set-up time for STOP condition	tsu;sto		0.6			μs	
Capacitive load on bus line	Св				400	pF	

Table 6 Communication timing specifications. The numbers above are values according to the I<sup>2</sup>C specification.

<sup>&</sup>lt;sup>10</sup> These values can be reduced by using the low power measurement mode, see separate application note.



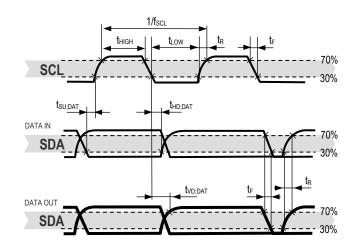

**Figure 4** Timing diagram for digital input/output pads. SDA directions are seen from the sensor. Bold SDA lines are controlled by the sensor, plain SDA lines are controlled by the micro-controller. Note that SDA valid read time is triggered by falling edge of preceding toggle.

# 4 Interface Specifications

The SHTC1 supports I<sup>2</sup>C fast mode (SCL clock frequency from 0 to 400 kHz) with clock stretching. For detailed information on the I<sup>2</sup>C protocol, refer to NXP I<sup>2</sup>C-bus specification and user manual UM10204, Rev. 4, February 13, 2012:

http://ics.nxp.com/support/documents/interface/pdf/I2C.bu s.specification.pdf

The SHTC1 comes in a 4-pin package - see Table 7.

Pin	Name	Comments	
1	VDD	Supply voltage	SHTC1
2	SCL	Serial clock, bidirectional	
3	SDA	Serial data, bidirectional	
4	VSS	Ground	<u>**10</u>

 Table 7 SHTC1 pin assignment (top view). The center pad is internally connected to VSS.

Power-supply pins supply voltage (VDD) and ground (VSS) must be decoupled with a 100 nF capacitor that shall be placed as close to the sensor as possible – see Figure 5.

SCL is used to synchronize the communication between microcontroller and the sensor. The master must keep the clock frequency within 0 to 400 kHz as specified in Table 6. The SHTC1 may pull down the SCL line when clock stretching is enabled.

The SDA pin is used to transfer data in and out of the sensor. For safe communication, the timing specifications defined in the  $I^2C$  manual must be met.

To avoid signal contention, the microcontroller must only drive SDA and SCL low. External pull-up resistors (e.g.  $10 \text{ k}\Omega$ ) are required to pull the signal high. For dimensioning resistor sizes please take bus capacity requirements into account. It should be noted that pull-up

resistors may be included in I/O circuits of microcontrollers.

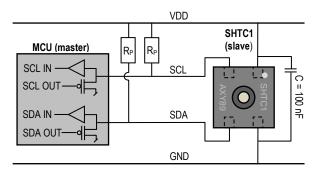


Figure 5 Typical application circuit, including pull-up resistors  $R_P$  and decoupling of VDD and VSS by a capacitor.

For good performance of the SHTC1 in the application, it is important to know that the center pad of the SHTC1 offers the best thermal contact to the temperature sensor. For more information on design-in, please refer to the document "SHTxx Design Guide".

For mechanical reasons the center pad should be soldered. Electrically, the center pad is internally connected to GND and may be connected to the GND net on the PCB or left floating.

# 5 Operation and Communication

All commands and memory locations of the SHTC1 are mapped to a 16-bit address space which can be accessed via the I<sup>2</sup>C protocol.

SHTC1	Bin.	Dec.	Hex.
I <sup>2</sup> C address	111'0000	112	0x70

Table 8 SHTC1 I<sup>2</sup>C device address.

### 5.1 Power-Up and Communication Start

Upon VDD reaching the power-up voltage level  $V_{\text{POR}},$  the SHTC1 enters idle state after a duration of  $t_{\text{PU}}.$  In idle

SENSIRION THE SENSOR COMPANY

state, the SHTC1 is ready to receive commands from the master (microcontroller).

Each transmission sequence begins with START condition (S) and ends with an (optional) STOP condition (P) as described in the I<sup>2</sup>C-bus specification. Whenever the sensor is powered up, but not performing a measurement or communicating, it automatically enters idle state for energy saving.

### 5.2 Measurement Commands

The SHTC1 provides the possibility to define the sensor behavior during measurement as well as the transmission sequence of measurement results. These characteristics are defined by the appropriate measurement command (see Table 9). Each measurement command triggers both a temperature *and* a humidity measurement.

Clock St	retching	Clock Stretching		
Enabled		Disabled		
Read T	Read H	Read T	Read H	
First	First	First	First	
0x7CA2	0x5C24	0x7866	0x58E0	

Table 9 Measurement commands.

### 5.3 Starting a Measurement

A measurement communication sequence consists of a START condition followed by the I<sup>2</sup>C header with the 7-bit I<sup>2</sup>C device address and a write bit (write W: '0'). The sensor indicates the proper reception of a byte by pulling the SDA pin low (ACK bit) after the falling edge of the 8th SCL clock. Then the sensor is ready to receive a 16-bit measurement command. Again, the SHTC1 acknowledges the proper reception of each byte with ACK condition. A complete measurement cycle is presented in Figure 6.

With the acknowledgement of the measurement command, the SHTC1 starts measuring humidity and temperature.

### 5.4 Sensor Behavior during Measurement and Clock Stretching

In general, the sensor does not respond to any I<sup>2</sup>C activity during measurement, i.e. I<sup>2</sup>C read and write headers are not acknowledged (NACK). However, when clock stretching has been enabled by using a corresponding measurement command, the sensor responds to a read header with an ACK and subsequently pulls down the SCL line until the measurement is complete. As soon as the measurement is complete, the sensor starts sending the measurement results.

During measurement, the sensor has a current consumption according to Table 3.

### 5.5 Readout of Measurement Results

After a measurement command has been issued and the sensor has completed the measurement, the master can

read the measurement results by sending a START condition followed by an I<sup>2</sup>C read header. The sensor will acknowledge the reception of the read header and send two bytes of data followed by one byte CRC checksum and another two bytes of data followed by one byte CRC checksum. Each byte must be acknowledged by the microcontroller with an ACK condition for the sensor to continue sending data. If the SHTC1 does not receive an ACK from the master after any byte of data, it will not continue sending data.

Whether the sensor sends out humidity or temperature data first depends on the measurement command that was sent to the sensor to initiate the measurement (see Table 9).

The I<sup>2</sup>C master can abort the read transfer with a NACK condition after any data byte if it is not interested in subsequent data, e.g. the CRC byte or the second measurement result, in order to save time.

In case the user needs humidity and temperature data but does not want to process CRC data, it is recommended to read the first two bytes of data with the CRC byte (without processing the CRC data) and abort the read transfer after reading the second two data bytes with a NACK. This procedure is more time efficient than starting two different measurements and aborting the read transfer after the first two data bytes each time.

### 5.6 Soft Reset

The SHTC1 provides a soft reset mechanism that forces the system into a well-defined state without removing the power supply. If the system is in idle state (i.e. if no measurement is in progress) the soft reset command can be sent to SHTC1 according to Figure 7. This triggers the sensor to reset all internal state machines and reload calibration data from the memory.

Command	Hex. Code	Bin. Code
Software reset	0x805D	1000'0000'0101'1101

 Table 10 Soft reset command.

### 5.7 Read-out of ID Register

The SHTC1 has an ID register which contains an SHTC1specific product code. The read-out of the ID register can be used to verify the presence of the sensor and proper communication. The command to read the ID register is shown in Table 11.

Command	Hex. Code	Bin. Code		
Read ID register	0xEFC8	1110'1111'1100'1000		
Table 11 Read-out command of ID register				

 Table 11 Read-out command of ID register.

It needs to be sent to the SHTC1 after an I<sup>2</sup>C write header. After the SHTC1 has acknowledged the proper reception of the command, the master can send an I<sup>2</sup>C read header and the SHTC1 will submit the 16-bit ID followed by 8 bits of CRC. The structure of the ID is described in Table 12.

16-bit ID	
<u>xxxx'xxxx'xx 0</u>	0'0111
	L bits 5 to 0: SHTC1-specific product code —— bits 15 to 6: unspecified information

**Table 12** Structure of the 16-bit ID. Bits 15:6 of the ID contain unspecified information (marked as "x"), which may vary from sensor to sensor, while bits 5:0 contain the SHTC1-specific product code.

### 5.8 Checksum Calculation

The 8-bit CRC checksum transmitted after each data word is generated by a CRC algorithm with the properties displayed in Table 13. The CRC covers the contents of the two previously transmitted data bytes.

Property	Value
Name	CRC-8
Width	8 bits
Polynomial	$0x31(x^8 + x^5 + x^4 + 1)$
Initialization	0xFF
Reflect input	False
Reflect output	False
Final XOR	0x00
Examples	CRC (0x00) = 0xAC CRC (0xBEEF) = 0x92

Table 13 SHTC1 I<sup>2</sup>C CRC properties.

# 5.9 Conversion of Signal Output

Measurement data is always transferred as 16-bit values. These values are already linearized and temperature compensated by the SHTC1. Humidity and temperature values can be calculated with the formulas in given below.

Relative humidity conversion formula (result in %RH):

$$RH = 100 \cdot \frac{S_{RH}}{2^{16}}$$

Temperature conversion formula (result in °C):

$$T = -45 + 175 \cdot \frac{S_{T}}{2^{16}}$$

 $S_{\text{RH}}$  and  $S_{\text{T}}$  denote the raw sensor output (as decimal values) for humidity and temperature, respectively.

### 5.10 Communication Data Sequences

	1	2 3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28										
s	1	1 1	0	0	0	0	0	ACK	0	1	0	1	1	1	0	0	ACK	0	0	1	0	0	1	0	0	ACK	Ρ		Sł	ITC	1 me	easu	iring		[		>
		I <sup>2</sup> C a	addre	ess +	- write	е			Me	ası	urem	ent	com	man	id M	SB		Me	easu	rem	ent	com	mar	nd L	SB		Μ	leas	uren	nent	in p	rogr	ess				
								1																													
	cloc	< streto	hing	1		29	30	) 3	1 32	2 3	33 3	43	53	63		83	9										40	41	42	43	44	45	46	47	48	49	]
	disa		////9			S	1	1	1	(	0	0	) (	) 1			P SI	HTC	1 m	eası	uring	9	SHT	C1 stat		lle	s	1	1	1	0	0	0	0	1	ACK	
									eateo mea							r	nea	sure	mer	nt co	nťd		mea co	sure mple					ľ	<sup>2</sup> C a	ddre	ess +	rea	ad			
l		$\langle$				29	30	) 3 <sup>,</sup>	1 32	2 3	3 34	4 35	36	37	38																						
	lock tretcl	hing e	nabl	ed		s	1	1	1	(	0	0	0	1	ACK			TC1 _ line																			
									l²C a le m					SS		m	eası	urem	ent	con	tinu	ed															
50	51	52 53	54	55	56 5	_		59 (	60 6	51	62 (	63 6	4 6	5 66		1		70	71	72	73	74	75	76	I												
1	0	1 0	0	0	0	1 Ì	ACK	0	0	1	1	0 0	)   1	1	ACK	2 0	0	0	1	1	1	0	0	ACK													
		Humid	ity M	SB					ŀ	lun	nidity	/LSI	3				Hun	nidity	/ CF	RC c	hec	ksur	n														
77	78	79 80	81	82	83 8	4 8	15 \$	36 8	878	8	89 9	90 9	19	2 93	8 94	95	96	97	98	۵۵	100	101	102	103	10/												
0		1 0	0	ļ	0 0		2				ļ	1 0		1		1	1	0	0	1	1	1			P												
	Te	empera	ature	MSE	3				Te	mp	eratu	ire L	SB			Te	emp	eratu	ure (	CRC	che	ecks	um			-											

**Figure 6** Communication sequence for starting a measurement and reading measurement results displaying both clock stretching options. The numerical example corresponds to a read humidity-first command with clock stretching enabled. The physical values of the transmitted measurement results are 65.6 %RH and 23.7 °C. Clear blocks are controlled by the microcontroller, grey blocks by the SHTC1.

_		1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28
	S	1	1	1	0	0	0	0	0	ACK	1	0	0	0	0	0	0	0	ACK	0	1	0	1	1	1	0	1	ACK	Ρ
			ľ	<sup>2</sup> C a	ddre	SS +	writ	e			Command MSB											Cor	nma	ind L	SB				

Figure 7 Command access communication sequence. The example shows a soft reset command. Clear blocks are controlled by the microcontroller, grey blocks by the SHTC1.

THE SENSOR COMPANY

# 6 Quality

### 6.1 Environmental Stability

Qualification of the SHTC1 is performed based on the JEDEC JESD47 qualification test method.

### 6.2 Material Contents

The device is fully RoHS and WEEE compliant, e.g. free of Pb, Cd, and Hg.

# 7 Packaging and Traceability

SHTC1 sensors are provided in a DFN package with an outline of  $2 \times 2 \times 0.75$  mm<sup>3</sup> and a terminal pitch of 1 mm. DFN stands for dual flat no leads. The humidity sensor opening is centered on the top side of the package.

The sensor chip is made of silicon and is mounted to a lead frame. The latter is made of Cu plated with Ni/Pd/Au. Chip and lead frame are overmolded by a green epoxy-based mold compound. Please note that the side walls of sensor are diced and therefore these diced lead frame surfaces are not covered with the respective plating.

All SHTC1 sensors are laser marked for easy identification and traceability. The marking on the sensor consists of two lines and a pin-1 indicator. The top line contains the sensor type (SHTC1), the bottom line contains a 5-digit, alphanumeric tracking code. The pin-1 indicator is located in the top left corner. See Figure 8 for illustration.



**Figure 8** Laser marking on SHTC1, the top line with the pin-1 indicator and the sensor type, the bottom line with the 5-digit alphanumeric tracking code.

Reels are also labeled and provide additional traceability information.


# 8 Ordering Information

The SHTC1 can be ordered in tape and reel packaging with 10'000 pcs. per reel. The sensors are supplied in reels with a diameter of 330 mm (13 inches), sealed into antistatic ESD bags. A drawing of the packaging tape with sensor orientation is shown in Figure 10.

THE SENSOR COMPANY



### 9.1 Package Outline

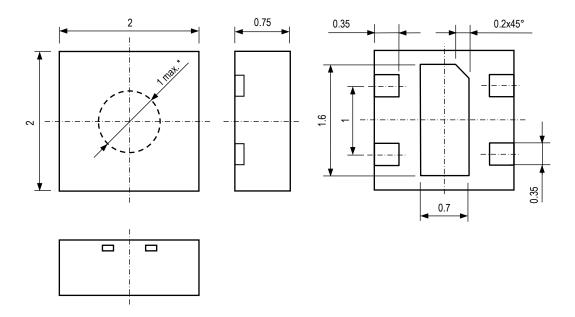

\* Mold opening shows smooth transition to package surface. Therefore this dimension is not well defined and given for reference only.

Figure 9 Package outline drawing of the SHTC1. Dimensions are given in millimeters.

### 9.2 Tape and Reel Package

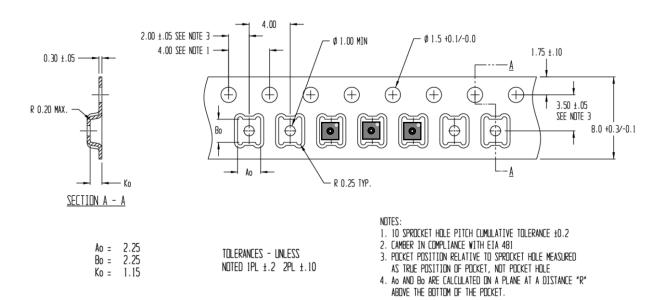


Figure 10 Technical drawing of the packaging tape with sensor orientation in tape. Header tape is to the right and trailer tape to the left on this drawing. Dimensions are given in millimeters.

# **10** Further Information

For more in-depth information on the SHTC1 and its application please consult the following doc	cuments:
---	----------

Document Name	Description	Source					
Application Guide for SHTC1	Instructions on soldering and processing of the	Available for download from the SHTC1 product website: www.sensirion.com/shtc1					
SHTxx Design Guide	Design guidelines for designing SHTXX numidity	Available for download at the Sensirion humidity sensors download center: www.sensirion.com/humidity-download					
SHTxx Handling Instructions	sensors	Available for download at the Sensirion humidity sensors download center: www.sensirion.com/humidity-download					
Sensirion Humidity Sensor Specification Statement	Definition of sensor specifications.	Available for download at the Sensirion humidity sensors download center: www.sensirion.com/humidity-download					

Table 14 Documents containing further information relevant for the SHTC1.

# **Revision History**

Date	Version	Page(s)	Changes								
February 21, 2013	1	all	Initial version								
May 21, 2013	2	6, 8	Section 5.2.1 removed, stop condition added to fig. 6								