# burster

9243 EN

# **Amplifier**

# Module for strain gauge and potentiommetric sensors

## **Model 9243**

CAD data 2D/3D for this device: Download directly at www.traceparts.com Info: refer to data sheet 80-CAD-EN



Rail mounting module



Code:



- Accuracy < 0.05 %
- Outputs ± 5 V, ±10 V and 0 (4) 20 mA
- 6 wire technique
- Isolation between signal and power supply
- Cut-off frequency 1 kHz, optional 4 kHz
- Configuration via DIP switches
- Easy installation on DIN mounting rail

#### Application

The amplifier module model 9243 is used wherever measurement signals from strain gauges, potentiometric sensors or DC/DC sensors have to be converted into standard signals. Simply by mounting on conventional DIN-mount rails, it is possible to position the amplifier module on location, in the proximity of the sensor. Especially for rough environments a IP65 version is available.

The broad auxiliary power range and the choice between AC or DC permits operation on standard power supplies used in switch gear cabinets. A highly precise reference voltage source is built-in for calibration purposes. A calibrating shunt can also be connected via two separate terminals. This permits deliberate detuning of a strain gauge sensor for calibration or merely to check the measuring chain.

# **Description**

A highly accurate precision amplifier performs the amplification of the sensor signal being applied. The necessary gain factor is adjusted coarsely with DIP switches while fine-tuning is carried out by using a potentiometer. Current and voltage outputs are available simultaneously. The sensor excitation is performed by the amplifier module itself so that no additional voltage source is required. It can also be set in steps of 2.5 V, 5 V, 10 V using DIP switches. The maximum feed current of 35 mA permits parallel connection of several strain gages, e.g. for the addition of measurement variables. Measurement errors brought about by varying line lengths or due to temperature fluctuations effecting the sensor cable are avoided by having probe lines measuring the actual feed voltage directly on site at the sensor itself (6 wire technology). Fluctuations are immediately corrected electronically. The cut-off frequency of the amplifier can be switched between 10 Hz and 1 kHz. The DIP switches for configuring the entire device are found easily accessible, under a cover.

# **Technical Data**

#### Connectable sensors

#### Strain gauges

Bridge resistances: 350 ...1000 Ω 4 or 6 wire Connection technology: Sensitivity: from 0.1 mV/V Excitation voltage: 2.5 V. 5 V. 10 V **Excitation current:** max. 35 mA

#### Potentiometer

1 kΩ ... 5 kΩ Resistance: Connection technology: 3 wire Measurement signal: 0 V ... 5 V Excitation voltage: 5 V Excitation current: max 35 mA selectable via DIP switches Zero shift:

#### Transmitter i.e. DC/DC

Measurement signal: 2.5 mV ... 10 V Excitation voltage: 2.5 V / 5 V / 10 V Excitation current: max. 35 mA

#### Sensor excitation

Voltage: 2.5 V. 5 V. 10 V via DIP switches Current: max. 35 mA

#### **Analog output**

Voltage output: max. 11.5 V at open terminals ±10 V 0 ... 20 mA Current output: or 4 ... 20 mA  $200 \dots 500 \Omega$ Load: with 10 V output: Output impedance: 470 Ω with monitor output: 10 kO

#### General amplifier data

Gain: 0.5 ... 50 000 (via DIP switches + potentiometer) Shift zero point: up to 100 % possible < 0.05% Accuracy: Temperature coefficient: < 50 ppm / K 0 -10 Hz or 0 -1000 Hz (via DIP switches) Frequency response: Electrical isolation: input and output with respect to power supply 50 V continuous

500 V test voltage 20 - 36 V DC Power supply:

14 - 26 V AC < 3 VA

Operating temperature: 0 ... 60 °C Stocking temperature: - 25 °C ... 70 °C

# Rail mounting module


Connections: terminal connector, 2 x 8 terminals Dimensions [W x H x D]: 45 x 75 x 108 [mm] Material: polyamide 6.6, color: green Assembly: on DIN EN 50 022 mount rails Protection class: IP20 Weight: approx. 250 g

# **IP65** version


Connection: terminal connector, 2 x 8 terminals Dimensions [W x H x D]: 160 x 100 x 65 [mm] Material: cast-aluminium Assembly: screw mounting Protection class: IP65 Weight: approx. 880 g Screen distance: 143 x 63 [mm] shaft screw ø 4.7 mm; screw ø 8.5 mm

## **Connection Schematic**

#### for strain gauge sensors, e.g. force, pressure or torque sensors

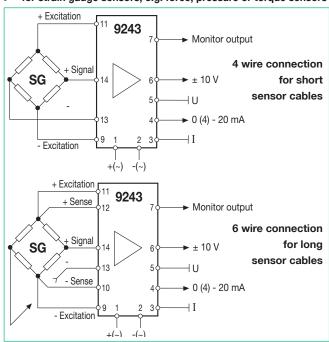

### for potentiometric sensors, e.g. displacement or angle sensors

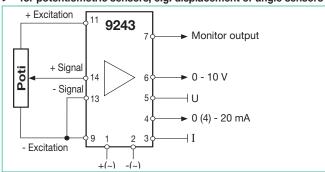

The CAD drawing (3D/2D) for this device can be imported online directly into your CAD system.

Download via www.burster.com or directly at www.traceparts.com. For further information about the burster traceparts cooperation refer to data sheet 80-CAD-EN.

# Manufacturers default settings

Excitation: 5 V Filter: 1 kHz 1320 ≙ 1.5 mV/V Gain (roughly): Integrated analog output: 10 V Current output: 0 ... 20 mA

#### **Order Code**

Amplifier module (rail mounting version) Model 9243 Amplifier module (IP65 housing) Model 9243-IP 65 Amplifier module (cut-off frequency 4 kHz Model 9243-V001

# Calibration of entire measuring chain

Consisting of sensor and amplifier model 9243 Model 9243-ABG

Please specify the adjustment data

e.g. 0 N  $\stackrel{\triangle}{=}$  0 V; 500 N  $\stackrel{\triangle}{=}$  10 V; cut-off frequency 1 kHz

# **Accessories**

Rail mounting transformer 230 V AC (115 V AC) / 24 V AC 12 VA for the power supply max. 4 amplifier modules Dimensions (W x H x D): 60 x 50 x 50 mm

Model 9243-Z001 in 230 V version in 115 V version Model 9243-Z002 Model 9900-V106 Plug-in socket; 8 pins

# **DMS Simulator**

for an easy adjustment of the amplifier to SG sensors (refer to data sheet 76-9405)